

LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Idg 10113 TDZE 815 Apt Elev 815
--	------------------------	--


ILS RWY 28L (SA CAT I & II)

JOHN GLENN COLUMBUS INTL (CMH)

⚠ Simultaneous approach authorized. SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting: requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.

MALS MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 on heading 210° and on APE VORTAC R-242 to LIMPS INT/ APE 34.2 DME and hold.



D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

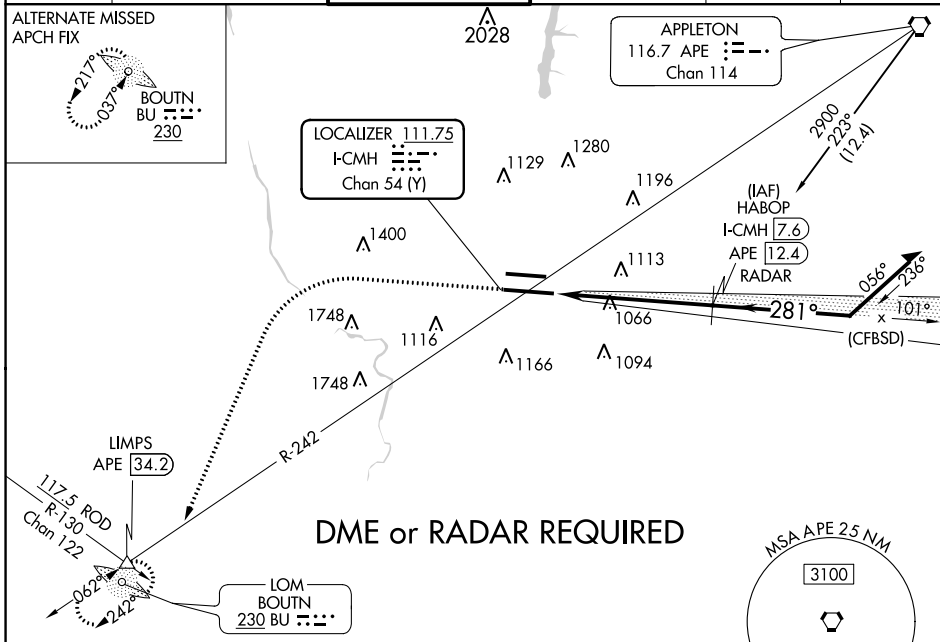

EC-2, 25 FEB 2021 to 25 MAR 2021

EC-2, 25 FEB 2021 to 25 MAR 2021

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

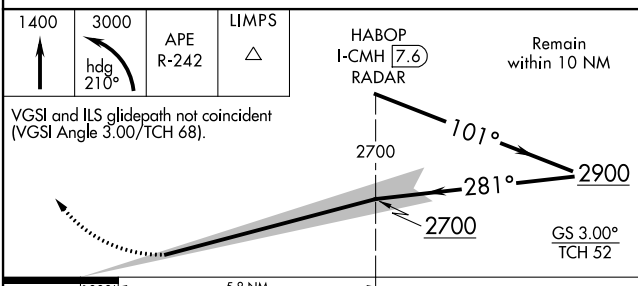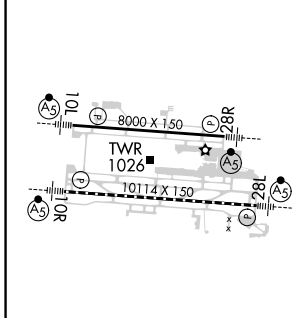

CATEGORY	A	B	C	D
S-ILS 28L	SA CAT I RA 157/14 150 DA 965			
S-ILS 28L	SA CAT II RA 100/12 100 DA 915			

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

COLUMBUS, OHIO
Amdt 30B 07DEC17

JOHN GLENN COLUMBUS INTL (CMH)
40°00'N-82°54'W
ILS RWY 28L (SA CAT I & II)