

COLUMBUS, OHIO

AL-5958 (FAA)

19339

LOC I-BUZ 111.7	APP CRS 037°	Rwy Idg TDZE Apt Elev	5500 904 904
---------------------------	------------------------	-----------------------------	---

ILS or LOC RWY 4

BOLTON FIELD (TZR)





ADF required.
RADAR required for procedure entry.

AutoPilot coupled approach NA below 1144.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 2700 direct BU LOM and hold.

AWOS-3 135.925	COLUMBUS APP CON 134.0 279.6	BOLTON TOWER ★ 128.1 (CTAF) 0	GND CON 121.8
--------------------------	--	---	-------------------------

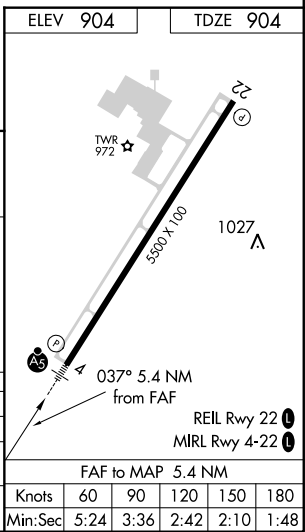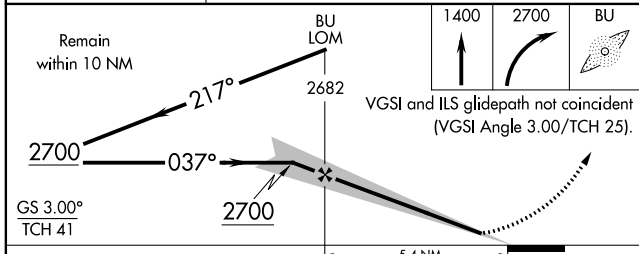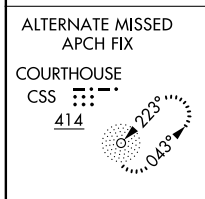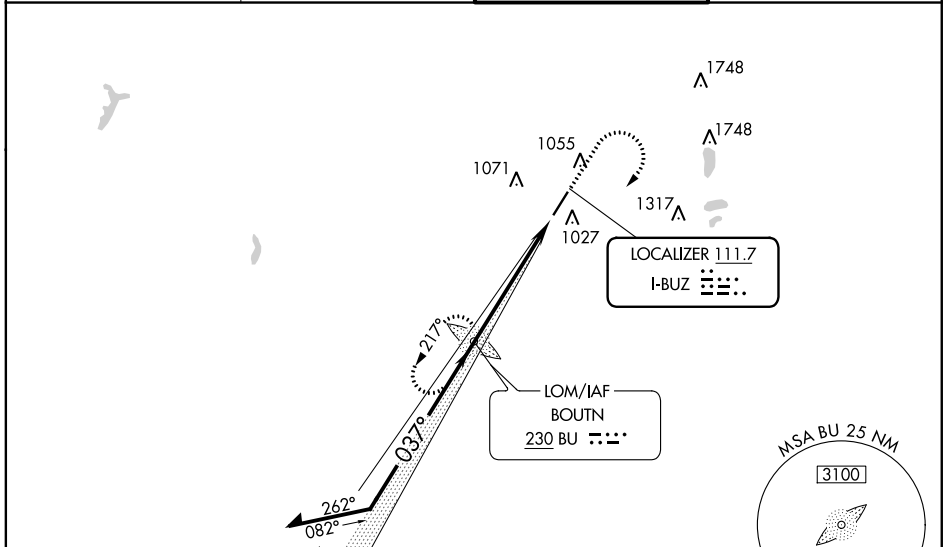

CATEGORY	A	B	C	D
S-ILS 4	1104-½		200 (200-½)	
S-LOC 4	1360-½ 456 (500-½)		1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

COLUMBUS, OHIO
Amdt 5B 05DEC19

39°54'N-83°08'W

BOLTON FIELD (TZR)

ILS or LOC RWY 4

EC-2, 25 FEB 2021 to 25 MAR 2021

EC-2, 25 FEB 2021 to 25 MAR 2021