


LOC/DME I-DDV 110.1 Chan 38	APP CRS 052°	Rwy Idg 12102 THRE 735 Apt Elev 744
---	------------------------	--

ILS RWY 5R (SA CAT I)
COLUMBUS / RICKENBACKER INTL (LCK)

A Procedure NA when using Port Columbus Intl altimeter setting. Requires specific OPSEC, MSPEC or LAO approval and use of HUD to DH.	ALSIF-2 	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
---	-------------	--



AWOS-3 132.75	COLUMBUS APP CON 119.15 279.6	RICK TOWER 120.05 348.4	GND CON 121.85 275.8
-------------------------	---	-----------------------------------	--------------------------------

ADF or DME REQUIRED

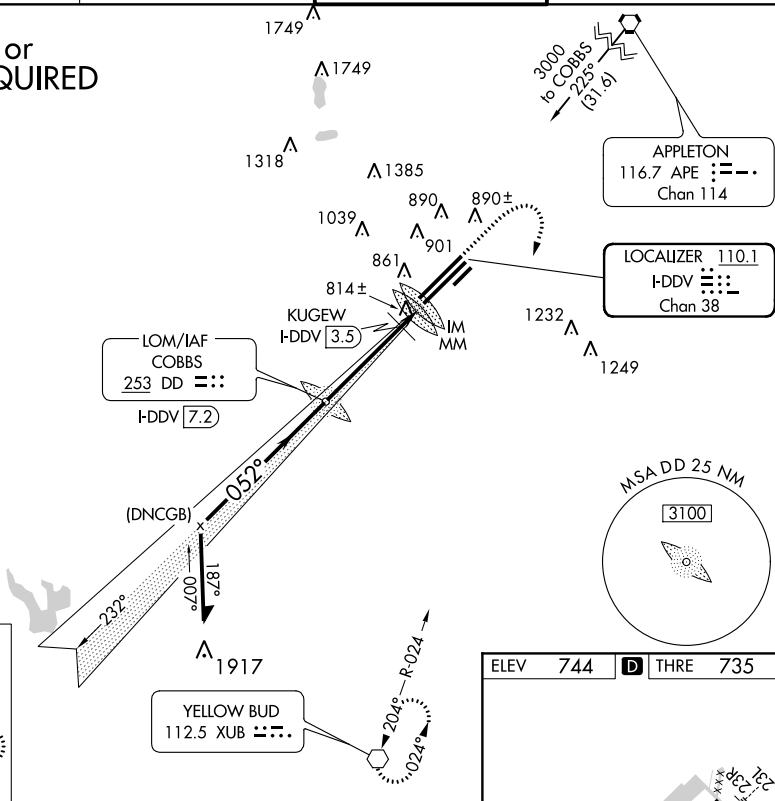


EC-2, 26 JUN 2014 to 24 JUL 2014

EC-2, 26 JUN 2014 to 24 JUL 2014

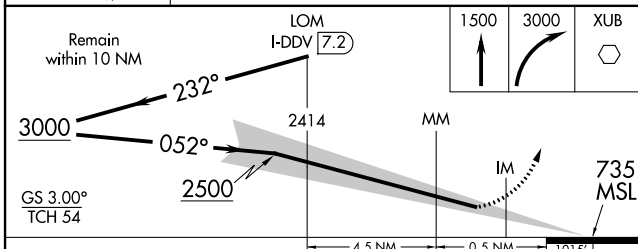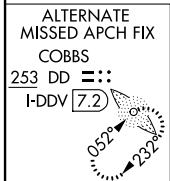

ELEV 744	D THRE 735
----------	-------------------

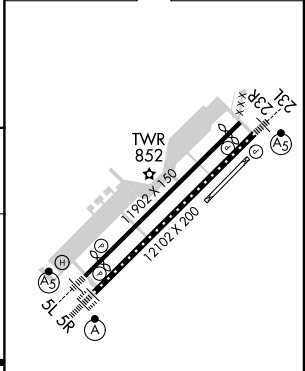

CATEGORY	A	B	C	D
S-ILS 5R	RA 150/14 150 DA 885			

SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

TDZ/CL Rwy 5R
REIL Rwy 23R
HIRL Rwys 5L-23R and 5R-23L