


APP CRS	Rwy Idg	10113
101°	TDZE	809
	Apt Elev	815

RNAV (RNP) Z RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.	MALSR	MISSED APPROACH: Climb to 3000 on track 101° to CORED and hold.
<p>Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -18°C or above 54°C. For inoperative ALS, increase RNP 0.17 all Cats visibility to RVR 5900, increase RNP 0.30 all Cats visibility to 1% SM.</p>		



D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

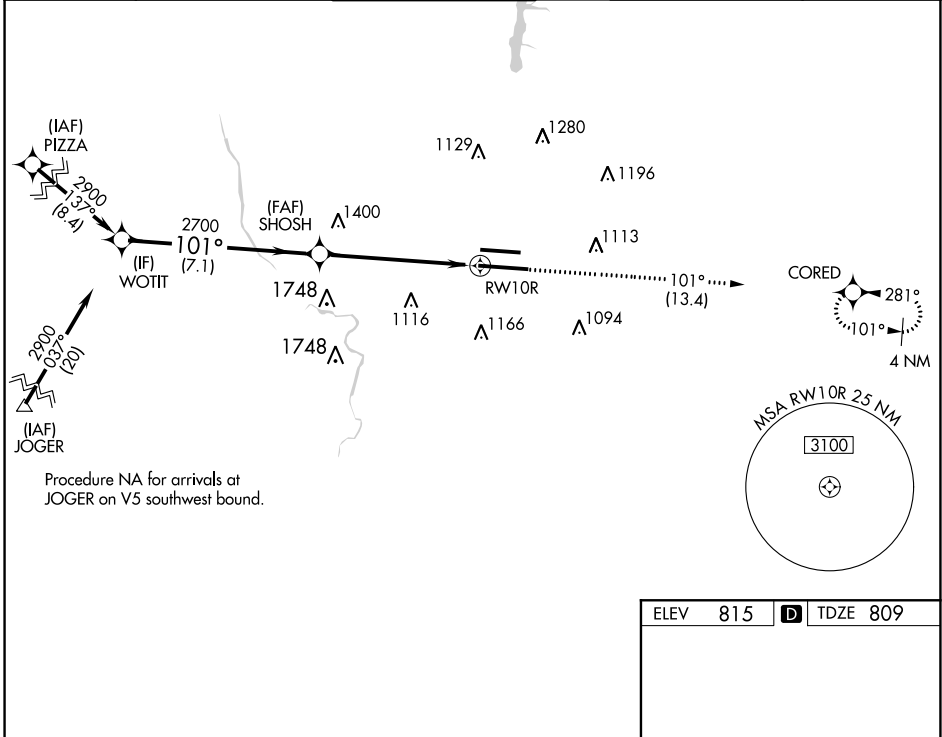

EC-2, 25 FEB 2021 to 25 MAR 2021

EC-2, 25 FEB 2021 to 25 MAR 2021

ELEV	815	D	TDZE	809
------	-----	----------	------	-----

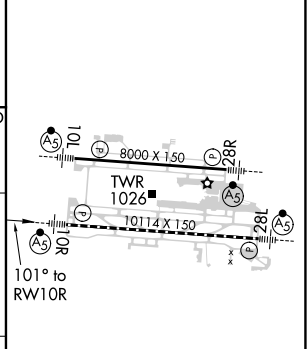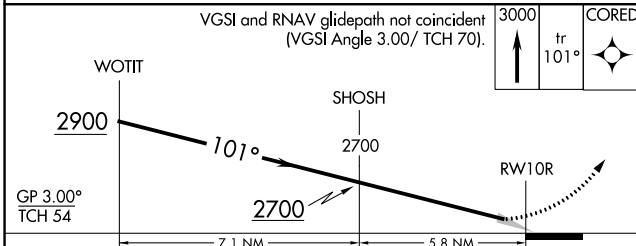

CATEGORY	A	B	C	D
RNP 0.17 DA		1171/35	362 (400- $\frac{5}{8}$)	
RNP 0.30 DA		1288/55	479 (500-1)	

AUTHORIZATION REQUIRED

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and 10L-28R