

DOVER, DELAWARE

ILS RWY 1 (CAT II)

DOVER AFB (KDOV)

LOC I-DOV 109.95	APCH CRS 015°	Rwy Idg TDZE Arprt Elev 9602 25 29
----------------------------	-------------------------	--

AL-562 [USAF]

RADAR or DME required.


ALSF-2

MISSED APPROACH: Climb to 2000 via DOV TACAN R-017 to DERE/DOV 6.7 DME and hold.

ATIS 127.825 273.5	DOVER APP CON 132.425 257.875	DOVER TOWER 126.35 279.625	GND CON 118.875 225.4	CLNC DEL 125.55 289.4
------------------------------	---	--------------------------------------	---------------------------------	---------------------------------



CATEGORY II ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

ENROUTE FACILITIES

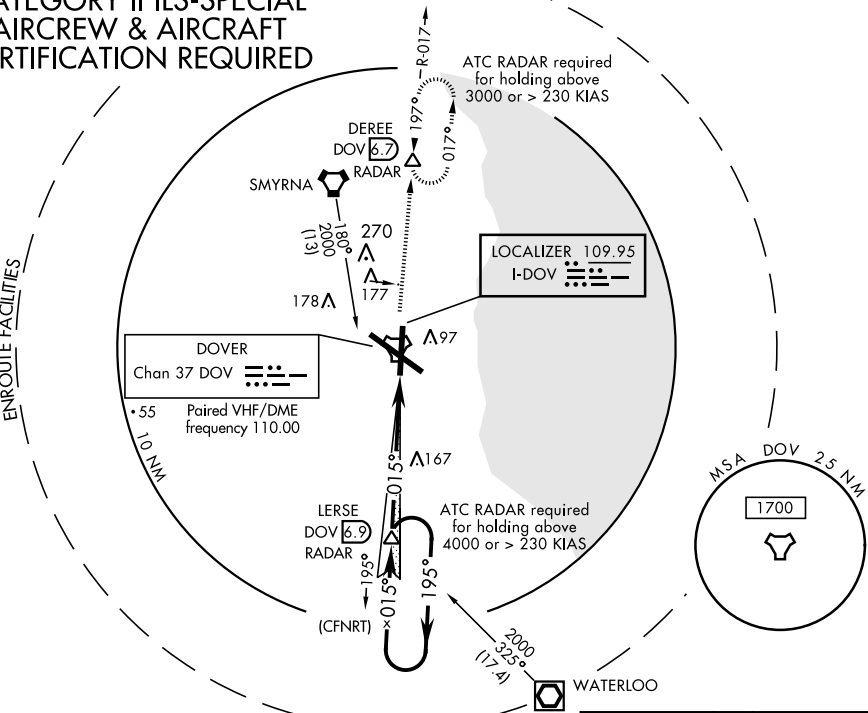


EMERG SAFE ALT 100 NM 4300

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 75).

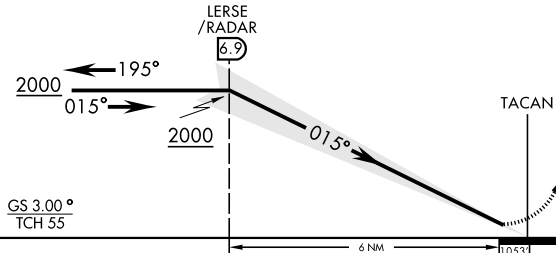

ELEV 29	TDZE 25
---------	---------

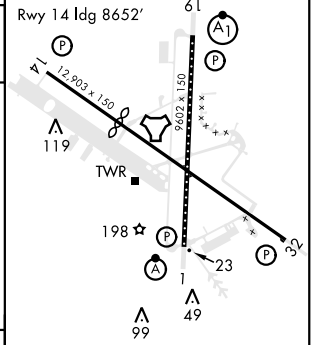

CATEGORY	A	B	C	D	E
S-ILS 1		RA 99/12	100	DA 125	

HIRL all Rwy REIL Rwy 32 TDZL/CL Rwy 1

DOVER, DELAWARE

39°08'N-75°28'W

DOVER AFB (KDOV)

Amdt 1 05DEC19

ILS RWY 1 (CAT II)

NE-3, 25 FEB 2021 to 25 MAR 2021

NE-3, 25 FEB 2021 to 25 MAR 2021